



TAP Information No 20 - August 2014

Vacuum Motor Appearance Change

Numatic International have moved production of their vacuum motors from North America to Europe. This will not affect performance but the look of the motor has changed for the 1200W version, in the future you will be required to order a different part number for the carbon brush on the 205403 240V DL2 1104T 1200W model.

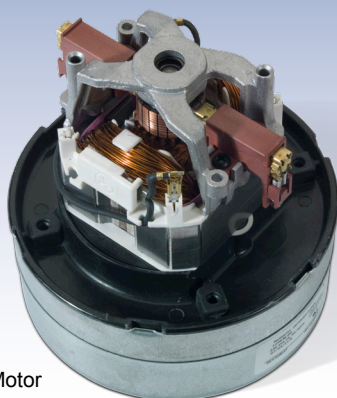

New DAF Motor

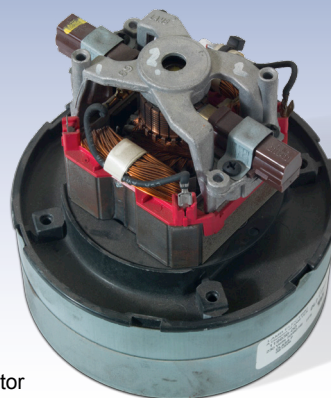

Old DAF Motor

Dry Motor Range Serial number starting at 1307



New By-Pass Motor



Old By-Pass Motor

Wet Motor Range Serial numbers starting at 1308

Motor	Description	Carbon Brush
205401	120V 2 stage Thro-Flow taper fan motor (DL21101T) TCO	230220
205402	This motor is obsolete	230155
205403 After serial No 1307	230V 2 stage Thro-Flow taper fan motor (DL21104T) TCO	230245
205403 Before serial No 1307	230V 2 stage Thro-Flow taper fan motor (DL21104T) TCO	230155
205405	120V 2 stage Thro-Flow taper fan motor (DL21101)	230220
205407	230V 2 stage Thro-Flow taper fan motor (DL21104)	230155
205415	120V 2 stage Thro-Flow motor (DL21101TA) tco (aircraft)	230280
205448	36V 1 stage direct air flow lamb motor (DL1-36300T) (064500031 36V DC)	
205413	120V 1 stage Thro-Flow cup motor (DL11101T) TCO	230250
205493	230V 1 stage Thro-Flow cup motor (DL11103t) TCO (marked 230V)	230180
205418	220V 2 stage Thro-Flow flat fan motor (DL21102RT) (marked 230V) TCO	230155
205419	240V 2 stage Thro-Flow flat fan motor (DL21104RT) (marked 230V) TCO	230155
205420	120V	230220
205460	120V 1 stage Thro-Flow cup motor (DL11101TA) tco (Aircraft)	230144
205327	230V 2 stage Thro-Flow taper fan eco motor (DL2804ET) TCO	230155

Important: Please note that when using the chart above for ordering replacement carbon brushes for the (205403) DL2 1104T 1200W, ensure you use the serial number of the machine to order the correct parts.



WARNING

Motor brushes must be replaced by a qualified technician.

